

ILS or LOC RWY 35L
ORLANDO INTL (MCO)

T Bright lights on highway midway between Rwy 35L and Rwy 35R may be mistaken for runway lights. Simultaneous approach authorized. When using alternate missed approach, simultaneous approach NA.

MISSED APPROACH: Climb to 3000 on heading 005° and ORL VORTAC R-049 to OVIDO INT/ORL 13 DME and hold.

ORLANDO, FLORIDA

ORLANDO
112.2 ORL
Chan 59

LOCALIZER 110.5
I-DDO
Chan 42

MLB R-329

OVIDO
113.7 OCF
Chan 84

ZOKUM INT
OMN 112.6 OMN
Chan 73

R-114


115.85 MLB
Chan 105 (Y)

1749

1749

Exec

100 Miles

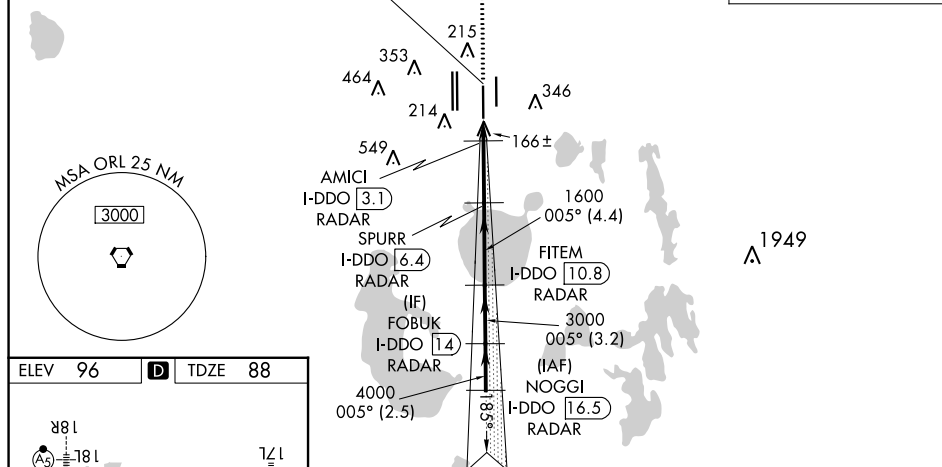

FAF to MAP 4.6 NM

Knots	60	90	120	150	180
Min:Sec	4:36	3:04	2:18	1:50	1:32

ILS Data Table:

Category	A	B	C	D
S-ILS 35L	288/18 200 (200-½)			
S-LOC 35L	420/24 332 (400-½)	420/26 332 (400-½)		

CIRCLING Data:

Category	A	B	C	D
CIRCLING	740-1 644 (700-1)	740-1¾ 644 (700-1¾)	740-2 644 (700-2)	